

Installation Instructions
AR WINDAMPER
Anti-Galloping System



Step (1)

Remove AR WINDAMPER aluminum panels from pallet. Locate package of 5/16" nuts, bolts, and washers for assembly of panels.

Step (2)

Assemble two AR WINDAMPER panels back-to-back with 4 nuts, 4 bolts, and 8 washers.

Step (3)

Locate AR CLAMP assembly with two 5/8" bolts, and 5/8" ANCO Locknut. Locate 5/8" x 5 1/2" bolt, split lock-washer, ANCO locknut. *If required, locate 4 corona donuts with 8 flat washers to bear against bracket and bolt/nut head.*

Step (4)

Mount AR CLAMP assembly to the two aluminum brackets at the top using the top holes. Bolt torque should be 50-55 ft.-lbs. The split lock-washer should flatten located under bolt head. *If required, corona donuts should cover bolt head and ANCO Locknut.*

Step (5)

Locate both 1/3 span points plus/minus 10 feet within span. Install one AR WINDAMPER unit on conductor at each 1/3 span point, *over furnished Helical Line armor rods if required.* Position keeper under clamp assembly, and tighten both bolts under keeper maintaining tight pressure against keeper.